
Kodak Ngenuity Series Scanners Firmware Release Notes

Version 2.01 Summary (09/24/2010)
(SC_7J3985_38660.pkg Package Activation ID is 38660)


This firmware update was created to allow a change from a B□we Bell and Howell (BBH) branded Ngenuity scanner to a Kodak branded Ngenuity scanner.

NOTE: Once a Böwe Bell and Howell (BBH) branded Ngenuity scanner has been updated with this firmware it must use the Ngenuity Operator Utility (NOU) and drivers provided on the Kodak Installation CDs version 1.0 or higher. Older versions of the NOU and drivers from CDs with a letter version (ie RevB or RevC) will no longer connect to the scanner.

To determine if an Ngenuity scanner is BBH branded or Kodak branded open Window's Device Manager (Right-click on My Computer and select Manage and then select Device Manager from the left pane's tree structure. If the scanner name starts with “BBH” then it is Böwe Bell and Howell branded scanner. If the scanner name starts with “Kodak” then the scanner is Kodak branded.

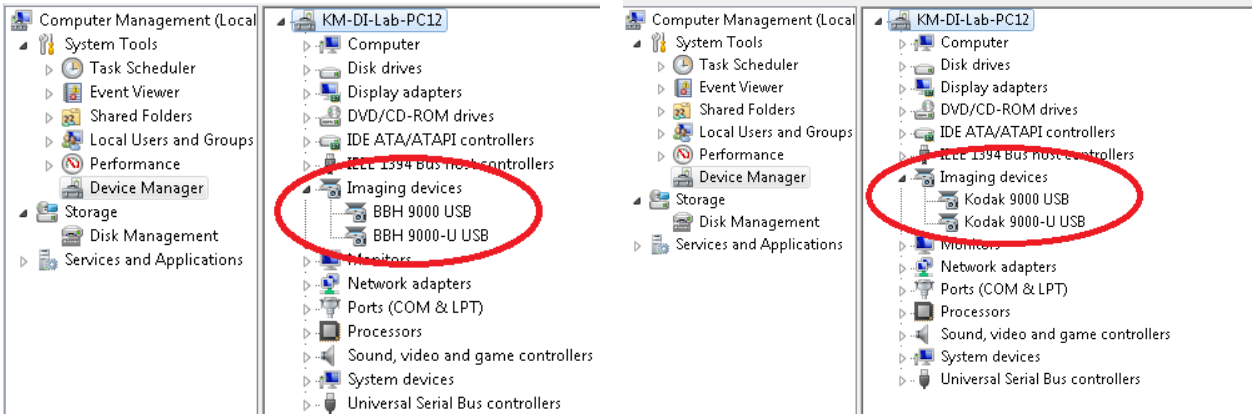

Version Details:

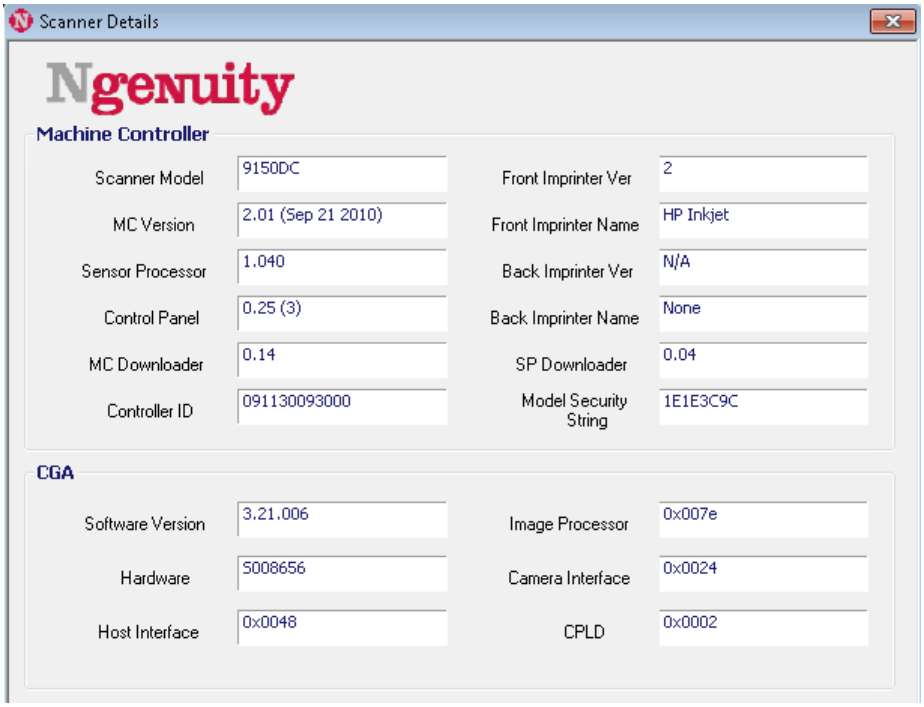

New Features from FW 1.14:

- Changes scanners VID/PID to support Kodak branded host drivers.
- Enables ability to use Patch Readers for Color Toggle Patch and Increment/Reset Print Counter on Patch.
- Enables new Multifeed Ignore option for Operator Panel button.
- Enables new Accelerated Scanning Image quality improvement for 300dpi scanning.
- Enables new Digitized Audio option (not available for scanners upgraded from BBH).
- Enables Independent front/back image border adjustment feature.

.

Improvements from FW 1.14:

- PR#15925 - Corrects an issue that may cause scanners to report a "Bad/Missing Front Panel" fault.
- PR#15130 - Camera calibration maintenance reminder now based on scanning time (LED On Time) instead of total scanner on time.
- PR#17228 - Corrects an issue that reset the odometer and other parameters to zero.
- Several other Issues were also corrected.